

# Manhole Inspection Summary

Manhole # S31I\_\_032MH

Printed On: 4/3/2009

Page 1 of 5

**Inspection** ☐ Is Incomplete Rating: **3) Fair**

Record Plat: **31I** Node: **032** Status: **Found**

Insp Date: **12/22/08 11:05 AM**

Incomplete Comments

Crew: **Wj,BH**  
Inspector: **wjenkins**  
Firm: **PER**

**Location** Address: **Dover St**

Cross Street: **Washington BD**

**Manhole** Type: **Junction**

Location: **Roadway**

Ground Conditions: **Dry**

☐ Prev. Rehab

Weather: **Dry**

Subject To Ponding: **None**

Comments

**Cover**

Shape: **Circular**

Diameter: **25.** (in.) Length: **0** (in.) Dist A/B Grade: **0** (in.)  
**5**

Type: **Sanitary**

Condition: **Worn**

Cover Material: **Cast Iron**

Properties: ☐ Bolted ☒ Vented ☐ Water Tight ☐ Water Tight Insert

**Frame**

Offset: **0** (in.)

Condition: ☐ Sound ☐ Cracked ☒ **Leaks**

**Chimney / Frame Adjustment**

☒ Exists Material: **Brick**

☐ Parged Height: **6** (in.)

Condition: ☐ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☒ **Deteriorated**

Infiltration: ☐ None ☒ **Joint** ☐ Cracks ☐ Mortar ☐ Roots ☐ Wall

**Corbel**

Material: **Brick**

☐ Parged

Type: **Concentric/Eccentric**

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☐ Deteriorated

Infiltration: ☐ None ☐ Joint ☐ Cracks ☐ Mortar ☐ Roots ☒ **Wall**

**Barrel**

Material: **Brick**

☐ Parged

Shape: **Circular** Diameter: **52** (in.) Length: **0** (in.)

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☐ Deteriorated

Infiltration: ☒ None ☐ Joint ☐ Cracks ☐ Mortar ☐ Roots ☐ Wall

**Bench**

☒ Exists Material: **Brick**

☐ Parged

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Deteriorated ☐ Leaks ☐ Debris

**Channel**

Material: **Brick**

☐ Parged

Channel Exposure: **Fully Open** Junc Dist: **0** nearest .5 ft. Azimuth: **0**

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Deteriorated ☐ Leaks ☐ Debris

**Steps**

Count: **7** Missing: **0** ☒ **Corroded**

**Surcharge**

☐ Evidence Of Surcharge Depth: **0** (ft.) ☐ Active Surcharge Present

# Manhole Inspection Summary

Manhole # S31I\_\_032MH

Printed On: 4/3/2009

Page 2 of 5

Location View



Top View



MISC



lid/frame infiltration

loc pic 3



cover pic



Defect 4



joint infiltration frame/chimney  
deteriorated

Defect 2



infiltration frame & chimney

Defect 1



corroded rungs, corbel infiltration debris  
on bench and channel

## Manhole Inspection Summary

Manhole # S31I\_\_032MH

Printed On: 4/3/2009

Page 4 of 5

10 in. Circular Gravity Sewer  
Pipe Out @ 12 O'Clock

12 O'Clock Outflow



Pipe Height: **10.8** (in.) Rod and Bar (Angled)  
Pipe Material: **Clay** ☐ Pipe Lined  
Invert Depth: **10.06** (ft.) Flow Characteristics: **Fast**  
Deposits: ☒ None ☐ Mud ☐ Sludge ☐ Debris ☐ Grease  
Silt Depth: **0** (in.) Deposits Extent:  
Infiltration: **None** Pipe Seal Cond: **Sound**

Drop: **None**

Connects To: **Manhole**

☐ Possible Illicit Connection

10 in. Circular Gravity Sewer  
Pipe In @ 2 O'Clock

2 O'Clock Inflow



Pipe Height: **10.8** (in.) Rod and Bar (Angled)  
Pipe Material: **PVC** ☐ Pipe Lined  
Invert Depth: **9.84** (ft.) Flow Characteristics: **Fast**  
Deposits: ☒ None ☐ Mud ☐ Sludge ☐ Debris ☐ Grease  
Silt Depth: **0** (in.) Deposits Extent:  
Infiltration: **None** Pipe Seal Cond: **Sound**

Drop: **None**

Connects To: **House connection / Service line**

☐ Possible Illicit Connection

## Manhole Inspection Summary


Manhole # S31I\_\_032MH

Printed On: 4/3/2009

Page 5 of 5

10 in. Circular Gravity Sewer  
Pipe Out @ 10 O'Clock

10 O'Clock Outflow

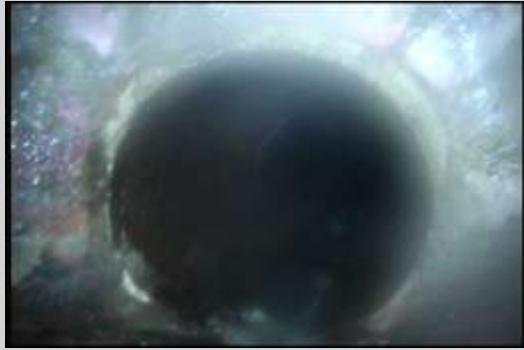

Pipe Height: **10.8** (in.) Rod and Bar (Angled)

Pipe Material: **Clay** ☐ Pipe Lined

Invert Depth: **10.46** (ft.) Flow Characteristics: **None**

Deposits: ☒ None ☐ Mud ☐ Sludge ☐ Debris ☐ Grease

Silt Depth: **0** (in.) Deposits Extent:

Infiltration: **None** Pipe Seal Cond: **Sound**

Drop: **None**

Connects To: **Manhole**

☐ Possible Illicit Connection